


# Parish of Weston under Penyard Public Rights of Way Survey Report No. 5



**Year Ending 31<sup>st</sup> March 2023**  
**John Smart**  
**Parish Footpaths Officer**

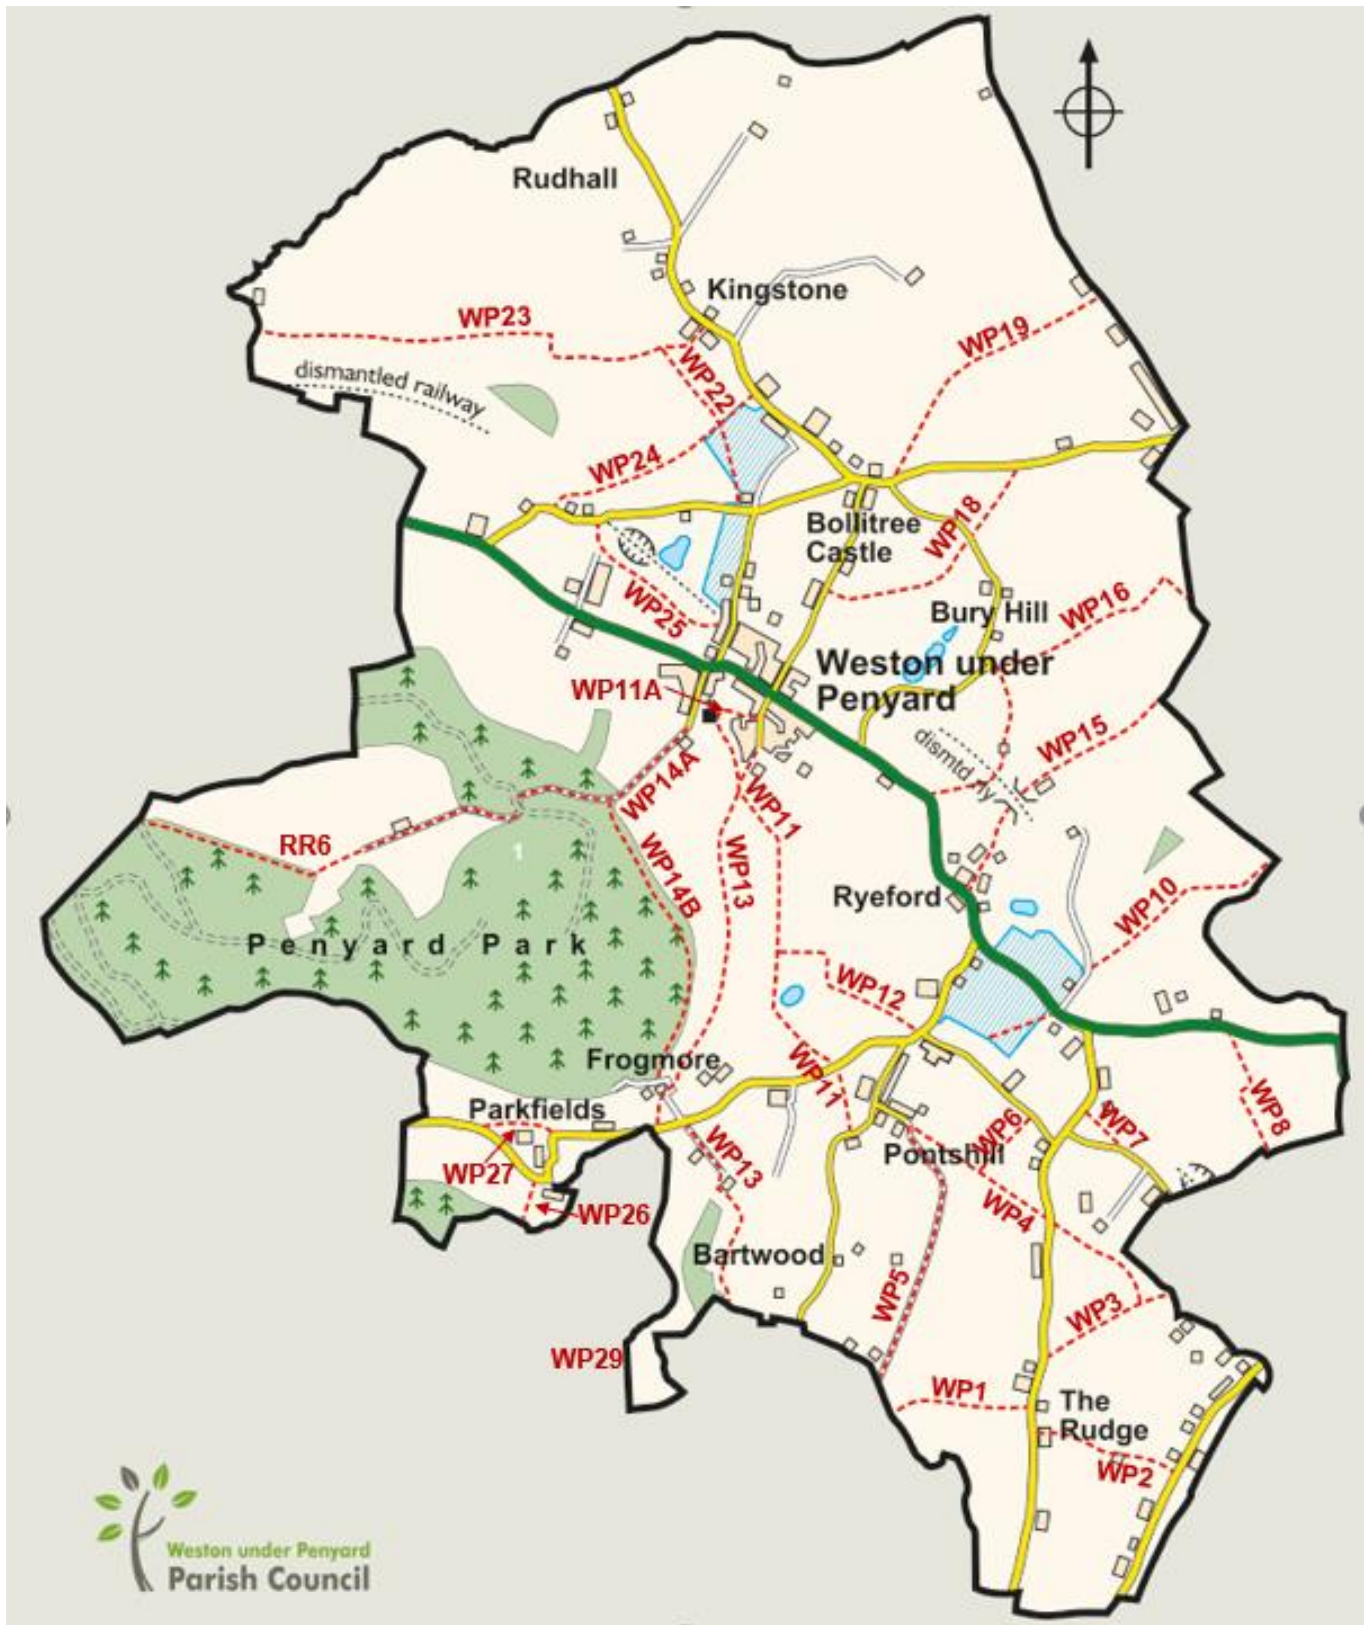

#### Abbreviations

|       |                                     |
|-------|-------------------------------------|
| WUPPC | Weston under Penyard Parish Council |
| HC    | Herefordshire Council               |
| HMPC  | Hope Mansell Parish Council         |
| BBLP  | Balfour Beatty Living Places        |
| PFO   | Parish Footpaths Officer            |
| PROW  | Public Right of Way                 |



## Introduction

In November 2016 the Parish Council (PC) endorsed a Baseline Survey of the Public Rights of Way (PROW) in the parish and adopted a Maintenance Plan for Public Rights of Way (PROW). Since then, an extensive programme of improvement has been undertaken. This Report No. 5 reflects this and provides a revised record of the current condition of the footpaths at the end of the financial year 2022-23.

Only official Public Rights of Way, as defined in the Herefordshire Council (HC) maps<sup>1</sup>, are included in the report. This includes one new path WP33 resulting from a footpath diversion from Walford parish into our parish during 2022.

There are 14 miles of footpaths in the parish, broken down into 29 listed footpaths defined by their HC numbering system e.g., WP1, WP2 etc. To identify each stile or gate a unique number was allocated during the 2016 Baseline Survey e.g., WP1/1, WP1/2 etc. In addition, there is footpath RR6 (Ross on Wye numbering) which is partly within the WuP parish, bringing the number to 30 in practical terms.

The PC has a Parish Paths Partnership Scheme (P3) agreement with Herefordshire Council under which the PC can undertake its own maintenance of the footpaths. From 31<sup>st</sup> March 2019 Herefordshire Council withdrew funding to parish councils under this scheme.

## Summary of Features

The surveys focus on the condition of the footpath furniture at the boundary points of hedgerows, fences and walls. A breakdown of these items is listed below:

| Boundary Features            | March 2023 Survey | October 2016 Survey |
|------------------------------|-------------------|---------------------|
| Gap                          | 23                | 17                  |
| Modern steel pedestrian gate | 36                | 5                   |
| Other older pedestrian gates | 19                | 15                  |
| Stiles                       | 20                | 59                  |
| Usable field gates           | 17                | 14                  |
| <b>Other Features</b>        |                   |                     |
| Bridges                      | 3                 | 5                   |
| Steps                        | 4                 | 2                   |
| In service dog gates         | 1                 | 3                   |

NB:

1. Included in the survey below is listed furniture which is just outside our boundary but impacts the use of the WUP footpaths. The above table excludes such furniture.
2. The above table includes a committed improvement at WP10/8 for which the gate has been bought but is waiting for installation by the landowner as of 31<sup>st</sup> March 2023. This upgrade is not included below in the survey report.

---

1

[https://www.herefordshire.gov.uk/info/200136/travel\\_and\\_transport/716/highways\\_and\\_public\\_rights\\_of\\_way\\_map](https://www.herefordshire.gov.uk/info/200136/travel_and_transport/716/highways_and_public_rights_of_way_map)

## **Overall improvements since Baseline Survey of October 2016**

1. Extensive improvements have been made involving the removal of stiles, thanks to the support from 24 landowners. Unfortunately, a few landowners have been unable to agree so far to the removal of seven isolated stiles that are preventing these routes reaching the status of "Miles Without Stiles".
2. The 2016 Baseline Survey noted that ten footpaths were impassable. This has now been reduced to only four footpaths and three of these are not significant.  
WP7 Not found - presumed overgrown. Not a contributor to the overall network  
WP27 No access over brook and through field gate. Still to be investigated by BBLP.  
WP31 Not found - presumed overgrown. Not a useful route.  
WP32 Not found - presumed overgrown. Not a useful route.

## **Unauthorised Changes Since October 2016**

1. On WP26 one unauthorised stile and one gap has been installed. After installation of the stile the two field gate were locked but more recently, they remain unlocked.
2. On WP4 a new boundary fence with an unauthorised Marlow gate has been installed. No inconvenience is being caused for walkers.

It has been noted that there are 9 footpaths where routes in current use diverge from the HC Definitive Map:

- WP2 between locations 7 and 8. (permissive path alternative in place)
- WP11 at location 5
- WP12 between locations 3 and 4 (the route is use is more convenient)
- WP13 at location 5 (the route is use is more convenient)
- WP14B at location 1 (the route is use is more convenient)
- WP22 between locations 1 and 3 (a path diversion proposal is in progress)
- WP24 between locations 2 and 3 (a path diversion proposal is expected)
- WP25 between locations 1 and 3 (permissive alternative in place)
- RR6 between locations 4 and 4 (the route is use is more convenient)

**List of Footpaths as described by Herefordshire Council.**

| <b>Reference</b> | <b>From</b>                                          | <b>To</b>                                |
|------------------|------------------------------------------------------|------------------------------------------|
| WP1              | C.rd. 130 yds. S of The Rudge                        | Old C bdy 120 yds. NW of Sylvan Cotts    |
| WP2              | C.rd. 230 yds. S of The Rudge                        | C.rd. 150 yds. NE of Lea Bailey Farm     |
| WP3              | C.rd. 50 yds. N of The Rudge                         | P.bdy. 100 yds. WSW of Newhouse Farm     |
| WP4              | C.rd. end of Pontshill 100 yds. SE of Croome Hall    | FP3, 200 yds. WSW of New House Farm      |
| WP5              | C.rd. end at Pontshill 100 yds. SE of Croome Hall    | P.bdy. 160 yds. SE of Red Ho Farm        |
| WP6              | C.rd. 100 yds. NW of Lane End                        | FP4, 250 yds. WSW of Lane End            |
| WP7              | C.rd. 70 yds. SSW of Wharton Farm                    | C.rd. 180 yds. E of Lane End             |
| WP8              | C.rd. 50 yds. E of Mitchfield Cotts                  | P.bdy. 330 yds. SW of Castle End Farm    |
| WP10             | C.rd. 100 yds. ESE of Travelling Hen (P.H) Pontshill | P.bdy. 300 yds. SW of Goomstool Cotts    |
| WP11             | C.rd. Pontshill Almshouses                           | St Lawrence Church Gate                  |
| WP11A            | St Lawrence Church Gate                              | C.rd. opp Weston Sch                     |
| WP12             | C.rd. at Pontshill Marsh                             | FP11, 330 yds. E of Birches barn         |
| WP13             | P.bdy. 270 yds. W of May Cott                        | C.rd. 100 yds. S of Weston Sch           |
| WP14A            | C.rd. 50 yds. SW of St Lawrence Church               | P.bdy. 420 yds. ENE of Lawns Farm        |
| WP14B            | FP14A, 480 yds. SW of St Lawrence Church             | FP13 near Penyard Lodge                  |
| WP15             | C.rd. at Ryeford                                     | P.bdy. 200 yds. SW of Eccleswall Farm    |
| WP16             | C.rd. 150 yds. ESE of Elm Cott                       | P.bdy. 200 yds. SW of Eccleswall Farm    |
| WP18             | C.rd. 100 yds. SW of Weston Rectory                  | C.rd. opp Hask Barn                      |
| WP19             | C.rd. 150 E of Bollitree Castle                      | C.rd 40 yds. ENE of Fording Lane         |
| WP22             | C.rd. at Woodfields Lodge                            | FP23, 150 yds. S.S.W of Kingstone Farm   |
| WP23             | C.rd. at Kingstone Farm                              | P.bdy. 100 yds. S of Lower Buildings     |
| WP24             | C.rd. 360 yds. E.N.E of Lower Weston Farm            | C.rd. opposite Dairy Cottages            |
| WP25             | C.rd. at Weston Halt                                 | C.rd. 470 yds. E.N.E. of Lower Weston Fm |
| WP26             | C.rd. 70 yds. S of Bill Mills                        | P.bdy. 60 yds. E of Knackers Hole        |
| WP27             | C.rd. 250 yds. W of Parkfields                       | C.rd. 250 yds. WNW of Bill Mills         |
| WP29             | P.bdy. 130 yds. WSE of Hopes Ash Farm                | P.bdy. at Palmer Flat                    |
| WP31             | C.rd. 130 yds. NNE Woodmore Cottage                  | C.bdy. a distance of 40 yds. to the E    |
| WP32             | C. rd. W. of Methodist Chapel                        | C. bdy. S. of Methodist Chapel           |

NB:

1. RR6 is partly within the parish of Weston under Penyard but is not listed under WUP by HC.
2. PROW Numbers 9, 17, 20, 21, 28, 30 are not used.

## PROW Details

| WP1    | Moving E to W                                                             | C.rd. 130 yds. S of The Rudge                                                                                                                                    | Old C bdy 120 yds. NW of Sylvan Cotts                                                                                             |                      |                                                                                       |
|--------|---------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------|----------------------|---------------------------------------------------------------------------------------|
| Survey | 13-March-2022                                                             | J Smart                                                                                                                                                          |                                                                                                                                   |                      |                                                                                       |
| No.    | Feature & Location                                                        | Condition                                                                                                                                                        | Action                                                                                                                            | GR                   | Photograph                                                                            |
| WP1/1  | Wooden Stile<br><br>From Rudge Pitch on C1277                             | Passable.<br><b>11-Mar.2023</b> – Landowner has agreed not to lock the gate., but visually it might appear to be locked. Both supports to stile step are broken. | <b>11-Mar.2023</b> – Remove broken step and add notice that the gate should be used. Consider replacement with a pedestrian gate. | SO<br>64294<br>20770 |    |
| WP1/2  | Stile has disintegrated and disappeared.<br><br>W of Rudge Pitch on C1277 | <b>11-Mar.2023</b> – Gate was maintained by PFO is 2022. Landowner has agreed to leave gate unlocked.                                                            | <b>11-Mar.2023</b> – None                                                                                                         | SO<br>64234<br>20768 |    |
| WP1/3  | Wooden Stile<br><br>W of Rudge Pitch on C1277                             | <b>11-Mar.2023</b> – Landowner has agreed to install a Marlow gate (purchased)                                                                                   | <b>11-Mar.2023</b> – gate scheduled for installation by Spring 2022.                                                              | SO<br>64133<br>20766 |    |
| WP1/3A | Wooden Stile<br><br>Behind house at SE end of Dancing Green Road          | <b>11-Mar.2023</b> – Landowner has agreed to install a Marlow gate (purchased)                                                                                   | <b>11-Mar.2023</b> – gate scheduled for installation by Spring 2022.                                                              | SO<br>63779<br>20748 |   |
| WP1/4  | Access<br><br>Access to track from Dancing Green Road                     | No finger post, only a waymarker. Likely to be grown over in the summer.                                                                                         | Erect finger post                                                                                                                 | SO<br>63720<br>20702 |  |

| WP2    | West to east                                              | C.rd. 230 yds. S of The Rudge                     | C.rd. 150 yds. NE of Lea Bailey Farm |                      |                                                                                       |
|--------|-----------------------------------------------------------|---------------------------------------------------|--------------------------------------|----------------------|---------------------------------------------------------------------------------------|
| Survey | Feb. 2022                                                 | J Smart                                           |                                      |                      |                                                                                       |
| No.    | Feature & Location                                        | Condition                                         | Action                               | GR                   | Photograph                                                                            |
| WP2/1  | Rough wooden gate<br><br>From C1277 at side of Sherbourne | OK.<br><br>New finger post installed by BBLP 2021 | None                                 | SO<br>64319<br>20655 |  |
| WP2/2  | Wooden gate<br><br>At rear of Sherbourne                  | OK.                                               | None                                 | SO<br>64326<br>20656 |  |

|          |                                                                        |                                                                                                         |                          |                      |                                                                                       |
|----------|------------------------------------------------------------------------|---------------------------------------------------------------------------------------------------------|--------------------------|----------------------|---------------------------------------------------------------------------------------|
| WP2/3    | Gap. Wooden Stile<br>E of Sherbourne                                   | Stile can be easily bypassed.                                                                           | None.                    | SO<br>64482<br>20651 |     |
| WP2/4    | Wooden bridge<br>W of Broome Hill                                      | <b>13-03-2022</b> – New bridge installed by BBLP                                                        | <b>13-03-2022</b> – None | SO<br>64500<br>20611 |    |
| Footpath | Wooden steps between WP2/4 and 5.<br>W of Broome Hill                  | <b>13-03-2022</b> – New steps installed by BBLP                                                         | <b>13-03-2022</b> – None |                      |    |
| WP2/5    | Marlow 1.0m<br>W of Broome Hill                                        | Good, but no cross-step, just parallel bars.<br><br><b>Nov-2022</b> Marlow gate installed by landowner. | <b>None</b>              | SO<br>64510<br>20614 |    |
| WP2/6    | Marlow 1.0m<br>Rear of Broome Hill                                     | <b>Nov-2022</b> Marlow gate installed by TGC.                                                           | <b>None</b>              | SO<br>64551<br>20618 |   |
| WP2/7    | Gap. Wooden stile<br>Rear of Broome Hill                               | 2023 stile removed                                                                                      | None                     | SO<br>64599<br>20584 |  |
| WP2/8    | Steel farm gate<br>On track E of Broome Hill                           | Good.<br>Gate was open.                                                                                 | None at present          | SO<br>64648<br>20567 |  |
| WP2/9    | Access from road with finger post.<br><br>Track leading to Broome Hill | Open access.                                                                                            | None.                    | SO<br>64802<br>20495 |  |

| WP3    | SW to NE                                                                                                                              | C.rd. 50 yds. N of The Rudge                                            | P.bdy. 100 yds. WSW of Newhouse Farm |                |                                                                                     |
|--------|---------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------|--------------------------------------|----------------|-------------------------------------------------------------------------------------|
| Survey | 13-March-2022                                                                                                                         | J Smart                                                                 |                                      |                |                                                                                     |
| No.    | Feature & Location                                                                                                                    | Condition                                                               | Action                               | GR             | Photograph                                                                          |
| WP3/1  | Bristol 3.6m 2-in-1 gate. Access from C1277 just N of The Rudge                                                                       | <b>13-03-2022</b> – Landowner has installed a Bristol 3.6m 2-in-1 gate  | <b>13-03-2022</b> – None             | SO 64347 20937 |  |
| WP3/2  | Bristol 2-in-1 gate<br><br>In valley NW of The Rudge                                                                                  | <b>28-03-2022</b> Bristol supplied by WUPPC and installed by landowner. | None                                 | SO 64658 21103 |  |
| WP3/3  | Gate<br>Access from Hoovers Lane SE of Newhouse Farm<br><b>NOTE: THIS STILE IS IN LEA PARISH. Boundary is between WP3/2 and WP3/3</b> | 2022 replaced by gate                                                   | None                                 | SO 64933 21160 |                                                                                     |

| WP4    | NW to SE                                                                                          | C.rd. end of Pontshill 100 yds. SE of Croome Hall                                    | FP3, 200 yds. WSW of New House Farm                                      |                |                                                                                       |
|--------|---------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------|--------------------------------------------------------------------------|----------------|---------------------------------------------------------------------------------------|
| Survey | 13-March-2022                                                                                     | J Smart                                                                              |                                                                          |                |                                                                                       |
| No.    | Feature & Location                                                                                | Condition                                                                            | Action                                                                   | GR             | Photograph                                                                            |
| WP4/1  | Wooden stile<br><br>Access from E end of Hanley Lane                                              | <b>Aug. 2019</b> – Replaced by WUPPC with new stile kit                              | <b>March.2022</b><br>Adjustment of step heights would be an improvement. | SO 63878 21770 |  |
| WP4/2  | Pedestrian steel gate<br><br>SE of Hanley Lane                                                    | Good condition. Not self-closing type.                                               | None                                                                     | SO 64060 21651 |  |
| WP4/3  | Wooden stile with planks over stream.<br><br>In valley SE of Hanley Lane                          | <b>Aug. 2019</b> – Replaced by WUPPC with new stile kit and planked bridge           | <b>Aug. 2019</b> – None                                                  | SO 64146 21590 |  |
| WP4/3A | Centrewire Marlow steel gate. Landowner installed new fence and gate without PC or BBLP approval. | Installed new in Nov.2020.<br><b>NOTE:</b> No furniture at this location previously. | None, whilst no inconvenience is being caused for walkers.               |                |  |
| WP4/4  | Woodstock Pedestrian<br><br>Access from W side of C1277, N of Little Wharton Farm                 | Provided and installed by WUPPC in Feb.2023                                          | None                                                                     | SO 64356 21414 |  |

|       |                                                                                                   |                              |      |                      |                                                                                    |
|-------|---------------------------------------------------------------------------------------------------|------------------------------|------|----------------------|------------------------------------------------------------------------------------|
| WP4/5 | Steel kissing gate.<br>Self-closing.<br><br>Access from E side of C1277, N of Little Wharton Farm | Good<br>(Installed in 2018.) | None | SO<br>64367<br>21425 |  |
|-------|---------------------------------------------------------------------------------------------------|------------------------------|------|----------------------|------------------------------------------------------------------------------------|

| WP5    | S to N                                                 | P.bdy. 160 yds. SE of Red House Farm                             | C.rd. end at Pontshill 100 yds. SE of Croome Hall                                                                      |                      |                                                                                       |
|--------|--------------------------------------------------------|------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------|----------------------|---------------------------------------------------------------------------------------|
| Survey | Feb-2022                                               | J Smart                                                          |                                                                                                                        |                      |                                                                                       |
| No.    | Feature & Location                                     | Condition                                                        | Action                                                                                                                 | GR                   | Photograph                                                                            |
| WP5/1  | Steel farm gate<br><br>Access from Dancing Green Road. | Gate has sagged and is difficult to open. Needs new hinge post.  | Discuss with Hope Mansell PC.<br><b>Note: This gate is in Hope Mansell parish. Boundary is between WP5/1 and WP5/2</b> | SO<br>63679<br>20804 |    |
| WP5/2  | Marlow 1.0m gate<br><br>NE of Dancing Green Road.      | Gate installed March 2023                                        | None                                                                                                                   | SO<br>63767<br>20919 |    |
| WP5/3  | Marlow 1.0m gate<br><br>SE corner of Handley gardens   | Gate installed March 2023                                        | None                                                                                                                   | SO<br>63870<br>21183 |   |
| WP5/4  | Stone wall stile<br><br>Entrance to drive to Handley.  | Good.<br>Gateway to drive of house is an alternative at present. | Consider later as a lesser priority.                                                                                   | SO<br>63897<br>21262 |  |

| WP6    | SW to NE                                                                                                    | FP4, 250 yds. WSW of Lane End                       | C.rd. 100 yds. NW of Lane End                          |                      |                                                                                       |
|--------|-------------------------------------------------------------------------------------------------------------|-----------------------------------------------------|--------------------------------------------------------|----------------------|---------------------------------------------------------------------------------------|
| Survey | 04.March.2022                                                                                               | J Smart                                             |                                                        |                      |                                                                                       |
| No.    | Feature & Location                                                                                          | Condition                                           | Action                                                 | GR                   | Photograph                                                                            |
| WP6/1  | New Woodstock Pedestrian installed March 2023<br><br>In valley SE of Lane End House on Pontshill Marsh Road | Woodstock Pedestrian                                | None                                                   | SO<br>64227<br>21666 |  |
| WP6/2  | Wooden stile<br><br>Access from Pontshill Marsh Road near Lane End House.                                   | <b>04.Mar.2022</b><br>Tall post broken and rocking. | <b>04.Mar.2022</b> –<br>Replace with gate or new stile | SO<br>64319<br>21758 |  |

|        |                                                  |                                                                            |                                                            |                              |            |
|--------|--------------------------------------------------|----------------------------------------------------------------------------|------------------------------------------------------------|------------------------------|------------|
| WP7    |                                                  | C.rd. 70 yds. SSW of Wharton Farm                                          |                                                            | C.rd. 180 yds. E of Lane End |            |
| Survey | 26-Jan-2019                                      | J Smart                                                                    |                                                            |                              |            |
| No.    | Feature & Location                               | Condition                                                                  | Action                                                     | GR                           | Photograph |
|        | Short footpath.<br><br>From C1277 to Hoover Lane | Footpath not found.<br>No evidence of access through hedgerows from roads. | Consider whether this footpath route has any future value. |                              | N/A        |

|        |                                                                                                                |                                                                                        |                                                                                   |                                       |                                                                                      |
|--------|----------------------------------------------------------------------------------------------------------------|----------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------|---------------------------------------|--------------------------------------------------------------------------------------|
| WP8    | N to S                                                                                                         | C.rd. 50 yds. E of Mitchfield Cotts                                                    |                                                                                   | P.bdy. 330 yds. SW of Castle End Farm |                                                                                      |
| Survey | March - 2022                                                                                                   | J Smart                                                                                |                                                                                   |                                       |                                                                                      |
| No.    | Feature & Location                                                                                             | Condition                                                                              | Action                                                                            | GR                                    | Photograph                                                                           |
| WP8/1  | Field gate.<br>Fingerpost<br><br>Access from A40 road just E of Wharton Lodge                                  | Bar fence could serve as stile but there are no steps. Gate was open.                  | None whilst gate remains unlocked.                                                | SO<br>65016<br>22081                  |   |
| WP8/2  | Temporary adjustable steel fencing. Installed since 2016.<br><br>SE of A40                                     | OK. Can be opened and closed.<br><b>Jan. 2023.</b><br>Fencing removed.<br>Open access. | None                                                                              | SO<br>65061<br>21843                  |   |
| WP8/3  | Wooden stile - SE of A40<br><br><b>NOTE: THIS STILE IS ON THE BOUNDARY WITH LEA PARISH. Landowner unknown.</b> | Old Herefordshire stile                                                                | <b>March 2022</b> – Should be replaced by new gate or stile or fitted with steps. | SO<br>65153<br>21678                  |  |

| WP10   | SW to NE                                                                                            | C.rd. 100 yds. ESE of Travelling Hen (P.H)<br>Pontshill                                                                                       | P.bdy. 300 yds. SW of Goomstool Cotts |                |                                                                                       |
|--------|-----------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------|----------------|---------------------------------------------------------------------------------------|
| Survey | March - 2022                                                                                        | J Smart                                                                                                                                       |                                       |                |                                                                                       |
| No.    | Feature & Location                                                                                  | Condition                                                                                                                                     | Action                                | GR             | Photograph                                                                            |
| WP10/1 | Open access<br><br>From Pontshill Marsh Road at SE side of Woodview houses                          | <b>2020</b> – Fingerpost uncovered.                                                                                                           | <b>2020</b> – None                    | SO 64041 22029 |    |
| WP10/2 | Steel kissing gate<br><br>At rear of houses on Pontshill Marsh Road.                                | Ancient but OK.                                                                                                                               | None at present                       | SO 64125 22077 |    |
| WP10/3 | Steel pedestrian gate.<br>Fingerpost<br><br>Access from A40 road, just W of Hownhall.               | Old but OK                                                                                                                                    | None                                  | SO 64385 22160 |    |
| WP10/4 | Fingerpost on opposite side of road.<br><br>Open access from A40 road onto track opposite Hownhall. | Gap                                                                                                                                           | None                                  | SO 64409 22168 |   |
| WP10/5 | Field gate open<br><br>NE of Hownhall                                                               | No stile sited                                                                                                                                | None                                  | SO 64434 22193 |  |
| WP10/6 | Field gate open.<br>Finger post.<br><br>NE of Hownhall                                              | 11-Mar-2023 – Old stile. Gate open.                                                                                                           | None whilst gate remains unlocked.    | SO 64505 22277 |  |
| WP10/7 | Wooden stile<br><br>NE of Hownhall                                                                  | <b>March 2021</b> – New stile installed. Not installed to BS5709.<br><b>March 2022</b> – Overall height is 96cm. The stepover height is 62cm. | None whilst field gate is not locked. | SO 64528 22296 |  |
| WP10/8 | New Marlow gate<br>SW of Goomstool Cottages on B4224 road.<br><b>NOTE: On boundary with Lea PC</b>  | <b>April 2023</b> – Gate purchased jointly with Lea PC and installed by Wharton Farm April 2023                                               | None                                  | SO 65061 22600 |  |

|        |                                                                                                                         |                                                   |                                                            |                      |                                                                                    |
|--------|-------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------|------------------------------------------------------------|----------------------|------------------------------------------------------------------------------------|
| WP10/9 | New Wooden stile<br>Fingerpost<br>Access from B4224<br>road, just S of<br>Goomstool Cottages.<br><b>NOTE: In Lea PC</b> | New stile installed<br>by landowner April<br>2023 | <b>March 2022</b><br>None whilst gate<br>remains unlocked. | SO<br>65234<br>22757 |  |
|--------|-------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------|------------------------------------------------------------|----------------------|------------------------------------------------------------------------------------|

| WP11   | N to S                                                                                            | St Lawrence Church Gate                                                                                                            | C.rd. Pontshill Almshouses                                                                                                                          |                      |                                                                                       |
|--------|---------------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------|----------------------|---------------------------------------------------------------------------------------|
| Survey | March - 2022                                                                                      | J Smart                                                                                                                            | "Round Ross" walk                                                                                                                                   |                      |                                                                                       |
| No.    | Feature & Location                                                                                | Condition                                                                                                                          | Action                                                                                                                                              | GR                   | Photograph                                                                            |
| WP11/1 | Wooden kissing gate.<br>Fingerpost<br><br>Entrance from<br>WP11A track at E<br>entrance to church | <b>March 2022</b><br>Loose timber<br>framework. Spring<br>recently fitted                                                          | None                                                                                                                                                | SO<br>63158<br>23233 |    |
| WP11/2 | New gate<br><br>SE of Church                                                                      | Good<br><b>Oct.2021</b> – Replaced<br>with SAF Dovey 0.7<br>with increased height<br>and onsite kissing<br>gate effect.            | <b>Oct.2021</b> - None                                                                                                                              | SO<br>63224<br>23166 |    |
| WP11/3 | Wooden gate with<br>spring.<br><br>On W side of track S<br>of Village Hall                        | Good                                                                                                                               | None                                                                                                                                                | SO<br>63273<br>22989 |   |
| WP11/4 | New gate<br>Fingerpost<br><br>On E side of track S of<br>Village Hall                             | Good.<br><b>Oct.2021</b> – Replaced<br>with SAF Dovey 0.7<br>with increased<br>height.                                             | <b>Oct.2021</b> - None                                                                                                                              | SO<br>63275<br>22985 |  |
| WP11/5 | Wooden Stile<br><br>S of Recreation<br>Ground                                                     | <b>Jan 2022</b> - Gate or<br>new stile not<br>acceptable to<br>landowner.<br>2022 – improvement<br>made to stile steps             | Hope to install gate<br>eventually at this key<br>location. Note that<br>the path is<br>considerably off the<br>definitive line of the<br>footpath. | SO<br>63449<br>22652 |  |
| WP11/6 | Wooden Stile<br><br>Near to stream                                                                | No cross-step, only<br>parallel bars.<br>Difficult to find due<br>to poor signage.<br>Gap to side avoids<br>the need to use stile. | <b>March 2022</b> Consider<br>whether this stile be<br>removed to widen<br>gap?                                                                     | SO<br>63364<br>22232 |  |
| WP11/7 | Stone footbridge<br><br>Crossing stream                                                           | Good                                                                                                                               | None                                                                                                                                                | SO<br>63363<br>22176 |  |

|         |                                                                        |                                                         |                        |                |                                                                                     |
|---------|------------------------------------------------------------------------|---------------------------------------------------------|------------------------|----------------|-------------------------------------------------------------------------------------|
| WP11/8  | Old steel kissing gate<br><br>Access from N side of C1275 road         | <b>2021</b> - Vegetation cleared                        | <b>2022</b> - None     | SO 63593 21973 |   |
| WP11/9  | Gap<br><br>Access from S side of C1275 road                            | <b>Jan.2021</b> – Gap created                           | <b>Jan 2022</b> - None | SO 63594 21966 |  |
| WP11/10 | Gap in hedgerow<br><br>Access from Bartwood Lane opposite The Wicketts | <b>May 2020</b> – Good steps created by local resident. | <b>May 2023</b> - None | SO 63672 21732 |  |

| WP11A   | Starting from E                                                                           | C.rd. opp Weston Sch | St Lawrence Church Gate |    |                                                                                      |
|---------|-------------------------------------------------------------------------------------------|----------------------|-------------------------|----|--------------------------------------------------------------------------------------|
| Survey  | 24-Feb-2019                                                                               | J Smart              |                         |    |                                                                                      |
| No.     | Feature & Location                                                                        | Condition            | Action                  | GR | Photograph                                                                           |
| WP11A/1 | Access<br>Fingerpost present<br><br>Entrance from School Lane to drive leading to Church. | Good                 | None                    |    |  |

| WP12    | SE to NW                                                                                     | C.rd. at Pontshill Marsh                                                | FP11, 330 yds. E of Birches barn   |                      |                                                                                      |
|---------|----------------------------------------------------------------------------------------------|-------------------------------------------------------------------------|------------------------------------|----------------------|--------------------------------------------------------------------------------------|
| Survey  | March - 2022                                                                                 | J Smart                                                                 |                                    |                      |                                                                                      |
| No.     | Feature & Location                                                                           | Condition                                                               | Action                             | GR                   | Photograph                                                                           |
| WP12/1  | Old steel field gate<br>Access from C1275 at junction with Bartwood Lane.<br><br>Fingerpost. | Reasonable. Can be opened with difficulty to provide access.            | None whilst gate remains unlocked. | SO<br>63831<br>22049 |   |
| WP12/1A | Tubular steel stile in wall.<br><br>North of WP12/1                                          | <b>Not on the PROW</b><br>Being used as an alternative access to WP12.  | None                               | SO<br>63863<br>22065 |   |
| P12/2   | Field gate<br><br>NW of C1275                                                                | OK. Not locked, but no stile or pedestrian gate.                        | None whilst gate remains unlocked. | SO<br>63765<br>22128 |   |
| WP12/3  | Steel field gate<br><br>NW of C1275 road                                                     | OK. Not fastened.                                                       | None whilst gate remains unlocked. | SO<br>63637<br>22209 |   |
| WP12/4  | Field gate<br><br>NW of C1275 road                                                           | OK. Gate is completely open and overgrown. No stile or pedestrian gate. | None whilst gate remains open.     | SO<br>63410<br>22375 |  |


| WP13   | N to S                                                                                          | P.bdy. 270 yds. W of May Cott                             | C.rd. 100 yds. S of Weston Sch          |                      |                                                                                       |
|--------|-------------------------------------------------------------------------------------------------|-----------------------------------------------------------|-----------------------------------------|----------------------|---------------------------------------------------------------------------------------|
| Survey | March - 2022                                                                                    | J Smart                                                   | "Round Ross" walk                       |                      |                                                                                       |
| No.    | Feature & Location                                                                              | Condition                                                 | Action                                  | GR                   | Photograph                                                                            |
| WP13/1 | Access<br>Fingerpost<br><br>Entrance from S end of School Lane alongside village Hall car park. | OK                                                        | None                                    | SO<br>63333<br>23102 |  |
|        | Next stile common to WP11. Ref. WP11/4.                                                         |                                                           |                                         |                      |                                                                                       |
| WP13/2 | Wooden stile<br><br>SSE of Village Hall                                                         | <b>March 2022</b> – New SAF Dovey gate installed.         | <b>March 2022</b> – None at present     | SO<br>63174<br>2271  |  |
| WP13/3 | Wooden stile<br><br>NE of Birches Barn                                                          | Good.<br><b>2022</b> – Steps repositioned to meet BS5709. | Hope to install new gate at some stage. | SO<br>63174<br>02271 |  |

|         |                                                                                                                            |                                                                                                                               |                                                                                                             |                      |                                                                                       |
|---------|----------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------------|----------------------|---------------------------------------------------------------------------------------|
| WP13/4  | Wooden stile<br><br>Access from track E of The Coach House                                                                 | Difficult.<br>Not constructed as a proper stile.<br>2022 -Landowner installed steps kit supplied by BBLP.                     | Hope to install a new gate at some stage                                                                    | SO<br>62985<br>21920 |     |
| WP13/5  | Wooden stile.<br>S of The Coach House.<br>Alternative access is being used through gap in hedge further down the driveway. | Stile loose, leaning with only parallel steps. Difficult.<br>Path is completely overgrown from stile over about 20m distance. | <b>March 2022</b> - None at present since a suitable gap is available nearby.                               | SO<br>62965<br>21881 |    |
| WP13/6  | Old steel field gate<br>Fingerpost<br>Access from N side of Bill Mills Road C1275, W of drive to The Coach House           | Gate partly open. Fingerpost not fixed and just leaning against wall.<br><b>2020</b> – new fingerpost installed.              | <b>March 2022</b> - None at present.                                                                        | SO<br>62970<br>21749 |    |
| WP13/7  | Access to Lane to Hartshill Fingerpost<br><br>Access from S side of Bill Mills Road C1275.                                 | OK                                                                                                                            | None                                                                                                        | SO<br>63061<br>21754 |    |
| WP13/8  | Steel gate in gate.<br><br>From Lane at Hartshill Cottage                                                                  | Good                                                                                                                          | None                                                                                                        | SO<br>63180<br>21566 |   |
| WP13/9  | Wooden stile<br><br>SE of Hartshill Cottage                                                                                | OK but this is not a stile but just a rough cross step in a bar fence. Field gate is normally open.                           | <b>March 2022</b> - None at present whilst field gate is kept open.                                         | SO<br>63248<br>21483 |  |
| WP13/10 | Wooden stile.<br>S of Hartshill Cottage<br><b>Note. Stile is on boundary with HMPC (footpath HM23)</b>                     | Repaired but still a very difficult stile.                                                                                    | Replace with gate.<br><br><b>March 2022</b> – HMPC has rejected WUPPC proposal on cost sharing for new gate | SO<br>63214<br>21126 |  |

| WP14A   | E to W                                                      | C.rd. 50 yds. SW of St Lawrence Church | P.bdy. 420 yds. ENE of Lawns Farm |                      |                                                                                     |
|---------|-------------------------------------------------------------|----------------------------------------|-----------------------------------|----------------------|-------------------------------------------------------------------------------------|
| Survey  | 24-Feb-2019                                                 | J Smart                                |                                   |                      |                                                                                     |
| No.     | Feature & Location                                          | Condition                              | Action                            | GR                   | Photograph                                                                          |
| WP14A/1 | Access<br>Fingerpost<br>Access to track from<br>Church Lane | OK                                     | None                              | SO<br>63082<br>23189 |  |
| WP14A/2 | Steel gate.<br><br>On lane at Junction<br>with WP14B.       | Good                                   | None                              | SO<br>62806<br>22930 |  |

| RR6    | E to W                                                             | NB - This footpath is numbered as a Ross on Wye parish footpath although the section described below is within the WuP parish.                 |                                                                                                              |                      |                                                                                       |
|--------|--------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------|----------------------|---------------------------------------------------------------------------------------|
| Survey | March 2022                                                         | J Smart                                                                                                                                        |                                                                                                              |                      |                                                                                       |
| No.    | Feature & Location                                                 | Condition                                                                                                                                      | Action                                                                                                       | GR                   | Photograph                                                                            |
| RR6/1  | Wooden Gate<br><br>Entrance to drive to<br>Lawns Farm              | Good                                                                                                                                           | None                                                                                                         | SO<br>62265<br>22892 |   |
| RR6/2  | Open Gateway<br><br>Adjacent to Lawns<br>Farm heading W            | Open.<br>No farm gate<br>No pedestrian stile or<br>gate.                                                                                       | None as long as the<br>gateway remains<br>open.                                                              | SO<br>62015<br>22787 |  |
| RR6/3  | Steel kissing gate<br><br>W of Lawns Farm                          | Good.<br>Slightly overgrown                                                                                                                    | Clear vegetation                                                                                             | SO<br>61884<br>22740 |  |
| RR6/4  | Steel kissing gate<br><br>W side of field at E<br>corner of woods. | Good                                                                                                                                           | None.                                                                                                        | SO<br>61728<br>22678 |  |
| RR6/5  | WuP boundary with<br>Ross on Wye                                   | Open path. The path<br>in use between 4 and<br>5 done does not<br>follow the definitive<br>map. The correct<br>route is becoming<br>overgrown. | None, whilst the path<br>is use remains clear.<br>Note – the path is<br>within an “Open<br>Access” woodland. | SO<br>61102<br>22868 |  |

| WP14B       | S to N                                                                   | FP13 near Penyard Lodge                                                                                                 | FP14A, 480 yds. SW of St Lawrence Church |                      |                                                                                     |
|-------------|--------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------------------------|------------------------------------------|----------------------|-------------------------------------------------------------------------------------|
| Survey      | 24-Feb-2019                                                              | J Smart                                                                                                                 |                                          |                      |                                                                                     |
| No.         | Feature                                                                  | Condition                                                                                                               | Action                                   | GR                   | Photograph                                                                          |
| WP14B/<br>1 | Open Path.<br><br>Link to WP13 just E of The Coach House                 | Footpath does not align with the route shown on the HC definitive maps, but the alternative route is in good condition. | None                                     | SO<br>62983<br>21902 |  |
| WP14B/<br>2 | Steel gate<br><br>Access from lane leading to Lawns Farm. Link to WP14A. | Good                                                                                                                    | None                                     | SO<br>62812<br>22923 |  |
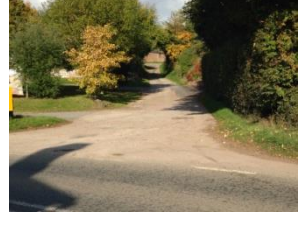
| WP15   | NE to SW                                                                                                          | P.bdy. 200 yds. SW of Eccleswall Farm                                                                                      | C.rd. at Ryeford                                         |                      |                                                                                       |
|--------|-------------------------------------------------------------------------------------------------------------------|----------------------------------------------------------------------------------------------------------------------------|----------------------------------------------------------|----------------------|---------------------------------------------------------------------------------------|
| Survey | January 2021                                                                                                      | J Smart                                                                                                                    |                                                          |                      |                                                                                       |
| No.    | Feature & Location                                                                                                | Condition                                                                                                                  | Action                                                   | GR                   | Photograph                                                                            |
| WP15/1 | Stile with dog gate. Fingerpost<br><br>Access from B4224 at entrance to Eccleswall Barns                          | OK                                                                                                                         | None<br><br><b>NOTE: THIS STILE IS IN LINTON PARISH.</b> | SO<br>65003<br>23784 |    |
| WP15/2 | Marlow 1.0m Gate<br>At rear of Eccleswall Barns<br><b>NOTE: THIS STILE IS ON THE BOUNDARY WITH LINTON PARISH.</b> | 26 <sup>th</sup> Nov.2020<br>New gate provided by WUP and Linton PCs and installed by R&D Green, Bollitree Farm            | None                                                     | SO<br>64913<br>23582 |   |
| WP15/3 | Centrewire Marlow steel gate<br><br>SW of Eccleswall Barn                                                         | New gate installed Jan. 2021. Provided by WUP installed by Wharton Farm                                                    |                                                          | SO<br>64656<br>23208 |  |
| WP15/4 | Wooden stile (BBLP kit)<br><br>NE of Greenway Cottage                                                             | <b>Jan 2021</b> - New stile installed by Wharton Farm (not in accordance with BS5709). Top rail removed to correct height. | None whilst gate is not locked. No sign of a chain.      | SO<br>64444<br>23067 |  |
| WP15/5 | Access onto track Fingerpost<br><br>From N side of A40 road in Ryeford, opposite Ryeford House.                   | Fingerpost likely to be overgrown and obscured in summer                                                                   | Clear hedgerow around Fingerpost                         | SO<br>64087<br>22584 |  |

|          |                                                                                                  |                                                                                                                                                                               |                                                                                                                                  |                      |                                                                                       |
|----------|--------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------------------------------------------------------------------------------------------|----------------------|---------------------------------------------------------------------------------------|
| WP16     | SW to NE                                                                                         | C.rd. 150 yds. ESE of Elm Cott                                                                                                                                                | P.bdy. 200 yds. SW of Eccleswall Farm                                                                                            |                      |                                                                                       |
| Survey   | March 2022                                                                                       | J Smart                                                                                                                                                                       |                                                                                                                                  |                      |                                                                                       |
| No.      | Feature & Location                                                                               | Condition                                                                                                                                                                     | Action                                                                                                                           | GR                   | Photograph                                                                            |
| WP16/1   | Wooden stile.<br>Fingerpost<br><br>Access from A40 road<br>SW of The Elms                        | No cross step.<br>Fingerpost<br>overgrown.<br>Adjacent open field<br>gate.                                                                                                    | Repair cross step<br>Clear vegetation<br><br><b>March 2022</b> – None,<br>whilst gate is kept<br>open.                           | SO<br>63929<br>22945 |    |
| WP16/2   | Marlow 1.0 Gate<br><br>S side of old railway<br>embankment near<br>Stroud Cottages               | <b>Oct. 2021</b> – New gate<br>installed.                                                                                                                                     | None.                                                                                                                            | SO<br>64158<br>22999 |    |
| Footpath | Steps.<br>North of WP16/2 on<br>south side of old<br>railway embankment,<br>S of Stroud Cottages | <b>April 2020</b> – BBLP<br>installed new steps<br><b>March 2022</b> - broken<br>handrail reported to<br>BBLP on 1 <sup>st</sup> Dec.<br>2020. Repaired by<br>HC in Nov.2022. | None                                                                                                                             | SO<br>64150<br>23010 |    |
| Footpath | Steps.<br>North of WP16/2 on<br>north side of old<br>railway embankment,<br>S of Stroud Cottages | <b>Feb.2023</b> – BBLP<br>installed new steps<br>on steep section of<br>path and re-graded<br>lower path.                                                                     | None                                                                                                                             |                      |   |
| WP16/3   | Woodstock<br>Pedestrian kissing<br>gate<br><br>N of Stroud Cottages                              | <b>Nov.2021</b><br>Gate supplied by<br>WUPPC and installed<br>by Lawns Farm                                                                                                   | None.                                                                                                                            | SO<br>64180<br>23123 |  |
| WP16/4   | Wooden kissing gate<br><br>Access from Bury Hill<br>Lane just E of The Old<br>Chapel.            | Gate hinge damaged.<br>New finger post<br>installed 2020 by<br>BBLP.                                                                                                          | None.                                                                                                                            | SO<br>64164<br>23388 |  |
| WP16/5   | Woodstock<br>Pedestrian kissing<br>gate<br><br>NE of The Old Chapel                              | <b>Nov.2021</b><br>Gate supplied by<br>WUPPC and installed<br>by Lawns Farm                                                                                                   | Gate it is not closing<br>correctly since it has<br>been installed out of<br>level by Lawns Farm<br>(owner has been<br>informed) | SO<br>64270<br>23430 |  |
| WP16/6   | Woodstock<br>Pedestrian kissing<br>gate<br><br>NE of The Old Chapel                              | <b>2022</b> - Marlow 1.0<br>purchased by WUPPC<br>and installed by TGC.                                                                                                       | None.                                                                                                                            | SO<br>64371<br>23506 |  |

| WP18   | NE to SW                                                                                         | C.rd. opp Hask Barn                                                         | C.rd. 100 yds. SW of Weston Rectory     |                      |                                                                                       |
|--------|--------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------|-----------------------------------------|----------------------|---------------------------------------------------------------------------------------|
| Survey | March 2022                                                                                       | J Smart                                                                     |                                         |                      |                                                                                       |
| No.    | Feature & Location                                                                               | Condition                                                                   | Action                                  | GR                   | Photograph                                                                            |
| WP18/1 | Marlow 1.0<br>Access from S side of C1280.<br>Weston/Bromsash road.                              | <b>2022</b> -<br>New gate supplied by WUPPC and installed by Bollitree Farm | None.                                   | SO<br>64237<br>24099 |    |
| WP18/2 | Marlow 1.0m.<br>Access from NE side of Bury Hill Lane.                                           | <b>2022</b> -<br>New gate supplied by WUPPC and installed by Bollitree Farm | None                                    | SO<br>64075<br>23860 |    |
| WP18/3 | Marlow 1.0 Gate<br>Access from SW side of Bury Hill Lane.                                        | <b>April 2021</b><br>Gate supplied by WUPPC and installed by Bollitree Farm | Repair stile<br>Clear vegetation        | SO<br>64071<br>23852 |    |
| WP18/4 | Wooden gate with spring<br><br>At rear of The Old Rectory                                        | <b>2021</b><br>New gate supplied by WUPPC and installed by The Old Rectory  | None.                                   | SO<br>63718<br>23668 |   |
| WP18/5 | Wooden field gate.<br><br>Access from SE corner of garden of The Old Rectory                     | Good, following maintenance by The Old Rectory                              | None, as long as gate remains unlocked. | SO<br>63696<br>23658 |  |
| WP18/6 | Wooden kissing gate<br>Fingerpost<br><br>Access from Rectory Lane into garden of The Old Rectory | Good.                                                                       | None.                                   | SO<br>63590<br>23678 |  |

| WP19   | NE to SW                                                                                                              | C.rd 40 yds. ENE of Fording Lane                                                                                                  | C.rd. 150 E of Bollitree Castle                                              |                      |                                                                                       |
|--------|-----------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------------------------------|----------------------|---------------------------------------------------------------------------------------|
| Survey | March 2022                                                                                                            | J Smart                                                                                                                           | "Round Ross" walk                                                            |                      |                                                                                       |
| No.    | Feature & Location                                                                                                    | Condition                                                                                                                         | Action                                                                       | GR                   | Photograph                                                                            |
| WP19/1 | Steel field gate.<br>No pedestrian gate or stile.<br><br>Access from B4224 road NW of Bromsash. Adjacent to Highmead. | Is free to swing open across the busy road.                                                                                       | Adjust post or hinges on gate and ensure that it cannot swing into the road. | SO<br>64541<br>24734 |    |
| WP19/2 | Wooden stile<br><br>SW of Highmead                                                                                    | Obstructed by loose fencing. Not in use but adjacent field gate is kept open or unlocked.                                         | None as long as gate remains unlocked.                                       | SO<br>64498<br>24694 |    |
| WP19/3 | Marlow 1.0m<br><br>SW of Highmead                                                                                     | <b>Oct 2021</b><br>New gate supplied and installed by WUPPC                                                                       | None at present                                                              | SO<br>64405<br>24644 |    |
| WP19/4 | Marlow 1.0m<br><br>SW of Highmead                                                                                     | <b>Oct 2021</b><br>New gate supplied and installed by WUPPC                                                                       | <b>March 2022</b><br>None                                                    | SO<br>64033<br>24455 |   |
| WP19/5 | Marlow 1.0m<br><br>In valley NE of Bollitree Cottage                                                                  | August 2021<br>New gate supplied by WUPPC and installed by Bollitree Farm. Posts seem to have been distorted during installation. | None.                                                                        | SO<br>63992<br>24412 |  |
| WP19/6 | Marlow 1.0m<br><br>On NE side of C1280 Weston-Bromsash Road just E of Bollitree Cottage                               | August 2021<br>New gate supplied by WUPPC and installed by Bollitree Farm.                                                        | None.                                                                        | SO<br>63803<br>24058 |  |

| WP22   | SE to NW                                                                                  | C.rd. at Woodfields Lodge                                                                                                                                                                                            | FP23, 150 yds. S.S.W of Kingstone Farm                                                                                                                                |                      |                                                                                       |
|--------|-------------------------------------------------------------------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------|---------------------------------------------------------------------------------------|
| Survey | March 2022                                                                                | J Smart                                                                                                                                                                                                              |                                                                                                                                                                       |                      |                                                                                       |
| No.    | Feature & Location                                                                        | Condition                                                                                                                                                                                                            | Action                                                                                                                                                                | GR                   | Photograph                                                                            |
| WP22/1 | Field gate.<br><br>W side of Woodfield Lodge on Springetts Lane.                          | Good.<br>Apparently not in use. Footpath through garden is being bypassed to the W.                                                                                                                                  | <b>March 2022</b><br>New finger post needed.<br>Landowner has submitted a proposal for footpath diversion.                                                            | SO<br>63282<br>23959 |    |
| WP22/2 | Wooden gate at rear of Woodfield Lodge                                                    | Good<br>Apparently not in use. Footpath through garden is being bypassed to the W.                                                                                                                                   | <b>March 2022</b><br>Woodfields has submitted a proposal for footpath diversion. Jan.2023 failed. <b>March 2023</b><br>New proposal for footpath diversion submitted. | SO<br>63288<br>23959 |    |
|        | Path through orchard and polytunnels.                                                     | The PROW was obstructed through the polytunnels. Walkers finding their way around the outside.<br><b>August 2022</b> – after discussions with Woodfields, they cleared a safe and easy path through the polytunnels. | <b>March 2022.</b><br>Woodfields has submitted a proposal for footpath diversion.                                                                                     | SO<br>63224<br>24187 |    |
|        | Defined footpath through orchard                                                          | Dec. 2021<br>Orchards have been cleared. No waymarkers.                                                                                                                                                              | <b>March 2022.</b><br>Woodfields has submitted a proposal for footpath diversion.                                                                                     | SO<br>63196<br>24306 |  |
|        | Crosses WP24/3                                                                            |                                                                                                                                                                                                                      |                                                                                                                                                                       |                      |                                                                                       |
| WP22/3 | Woodstock Pedestrian kissing gate<br><br>South of Kingstone Court                         | Nov. 2021<br>New gate supplied by WUPPC and installed by Weston Hall Farm                                                                                                                                            | None.                                                                                                                                                                 | SO<br>63126<br>24365 |  |
| WP22/4 | Unrestricted FP.<br>Temporary stile removed in 2020<br><br>SW of Kingstone Court          |                                                                                                                                                                                                                      | None.                                                                                                                                                                 | SO<br>63064<br>24510 | N/A                                                                                   |
| WP22/5 | Unrestricted FP.<br>Temporary gate and fence removed in 2020.<br><br>W of Kingstone Court |                                                                                                                                                                                                                      | None                                                                                                                                                                  | SO<br>63058<br>24539 | N/A                                                                                   |

| WP23   | E to W                                                                            | C.rd. at Kingstone Farm                                                  | P.bdy. 100 yds. S of Lower Buildings |                      |                                                                                       |
|--------|-----------------------------------------------------------------------------------|--------------------------------------------------------------------------|--------------------------------------|----------------------|---------------------------------------------------------------------------------------|
| Survey | March 2022                                                                        | J Smart                                                                  |                                      |                      |                                                                                       |
| No.    | Feature & Location                                                                | Condition                                                                | Action                               | GR                   | Photograph                                                                            |
| WP23/1 | Fingerpost<br>Access from SW side of C1283 road<br>Bollitree-Rudhall at Kingstone | OK                                                                       | None                                 | SO<br>63145<br>24621 |    |
| WP23/2 | Wooden bridge with step-overs at each end (installed 2017).<br><br>W of Kingstone | Good.<br>Middle cross rails removed in 2021 with approval of landowners. | None                                 | SO<br>62587<br>24570 |    |
| WP23/3 | Marlow 1.0 gate<br><br>W of Kingstone                                             | July 2021<br>New gate supplied by WUPPC and installed by Model Farm      | OK at present.                       | SO<br>62233<br>24584 |    |
| WP23/4 | Marlow 1.0 gate<br><br>W of Kingstone                                             | July 2021<br>New gate supplied by WUPPC and installed by Model Farm      | None.                                | SO<br>61840<br>24576 |   |
| WP23/5 | Wooden pedestrian gate.<br><br>E side of farm track N of Highfield Farm           | Vegetation needs to be cut regularly to avoid obstruction.               | None.                                | SO<br>61507<br>24611 |  |

| WP24   | SW to NE                                                                                                                                                                                                                                                                          | C.rd. 360 yds. E.N.E of Lower Weston Farm                                                             |                                                                                                                                     | C.rd. opposite Dairy Cottages |                                                                                      |
|--------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------|-------------------------------|--------------------------------------------------------------------------------------|
| Survey | March 2022                                                                                                                                                                                                                                                                        | J Smart                                                                                               |                                                                                                                                     |                               |                                                                                      |
| No.    | Feature & Location                                                                                                                                                                                                                                                                | Condition                                                                                             | Action                                                                                                                              | GR                            | Photograph                                                                           |
| WP24/1 | BS Wooden stile<br><br>N side of Springetts lane adjacent to bungalow                                                                                                                                                                                                             | Good.<br>2020 - New BS stile installed by Weston Hall Farm. Adjoining farm gate is normally unlocked. | Stile is acceptable at present once field gate is kept open. Stile could benefit from the steps being raised to the correct height. | SO<br>62643<br>23936          |   |
| WP24/2 | Woodstock Pedestrian kissing gate<br><br>N of Rock Cottage                                                                                                                                                                                                                        | <b>Summer 2021</b><br>New gate supplied by WUPPC and installed by Weston Hall Farm                    | None                                                                                                                                | SO<br>62697<br>24013          |   |
| Note   | <b>March 2023.</b><br>Between 2 and 3 the definitive path is poorly defined and is obstructed in parts by polytunnels and a storage yard. Walkers normally avoid this be following the track around the side, to the NW. A permanent diversion is being discussed with landowner. |                                                                                                       |                                                                                                                                     |                               |                                                                                      |
| WP24/3 | Woodstock Pedestrian kissing gate<br><br>W of Woodfields                                                                                                                                                                                                                          | <b>Summer 2021</b><br>New gate supplied by WUPPC and installed by Weston Hall Farm                    | None                                                                                                                                | SO<br>63304<br>24395          |   |
| WP24/4 | Access from SW side of C1283 road opposite Porch Cottages                                                                                                                                                                                                                         | <b>2022</b> - Bristol 2-in-1 gate supplied by WUPPC and installed by Weston Hall Farm.                | None                                                                                                                                | SO<br>63304<br>24395          |  |

| WP25   | SE to NW                                                                                                                                | C.rd. at Weston Halt                                                                    |                                                                                            | C.rd. 470 yds. E.N.E. of Lower Weston Fm |                                                                                       |
|--------|-----------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------|------------------------------------------|---------------------------------------------------------------------------------------|
| Survey | March 2022                                                                                                                              | J Smart                                                                                 |                                                                                            |                                          |                                                                                       |
| No.    | Feature & Location                                                                                                                      | Condition                                                                               | Action                                                                                     | GR                                       | Photograph                                                                            |
| WP25/1 | Fingerpost.<br>Helpful notice on gate of Stonewold.<br><br>Access from W side of Whitehall Road between St Marys Cottage and Stonewold. | Good.<br>Note: From this point a permissive footpath has been created by the landowner. | The “Footpath Users” notice and entrance to the narrow path should be made more prominent. | SO<br>63232<br>23533                     |  |
| WP25/2 | Wooden gate<br><br>At rear of St Marys Cottage                                                                                          | Wooden gate.                                                                            | None.                                                                                      | SO<br>63160<br>23532                     |  |

|        |                                                                                                    |                                                                                                           |                                                                                                                        |                      |                                                                                      |
|--------|----------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------|----------------------|--------------------------------------------------------------------------------------|
| WP25/3 | Steel field gate<br>Electric fences in this area.<br><br>At rear of Stonewold                      | Difficult since the bolt is sometimes not aligned.<br>Footpath returns to definitive route at this point. | <b>March 2022</b><br>Gate needed adjustment.<br>Try to avoid using electric fencing next to and crossing the footpath. | SO<br>63144<br>23571 |    |
| WP25/4 | Gap in electric fence<br><br>At rear of Stonewold                                                  | Insulated handles on electric fence allow this gap to be opened and closed.<br>Sometimes extremely muddy. | Try to avoid using electric fencing across the footpath.                                                               | SO<br>63099<br>23591 |   |
| WP25/5 | Wooden stile<br><br>W of Stonewold                                                                 | Old Hereford standard.                                                                                    | <b>March 2022</b><br>Stile should be replaced with gate or new stile. Not accepted by landowner.                       | SO<br>63050<br>23627 |   |
| WP25/6 | Marlow 1.0 Gate<br><br>At rear of Penyard House                                                    | <b>April 2021</b><br>New gate supplied by WUPPC and installed by Weston Hall Farm                         | None                                                                                                                   | SO<br>62831<br>23784 |   |
| WP25/7 | Woodstock Pedestrian kissing gate. Fingerpost. On S. side of Springetts Lane opposite Rock Cottage | <b>October 2021</b><br>New gate supplied by WUPPC and installed by Weston Hall Farm                       | None                                                                                                                   | SO<br>62746<br>23912 |  |

| WP26   | N to S                                                                                                                                                   | C.rd. 70 yds. S of Bill Mills      | P.bdy. 60 yds. E of Knackers Hole                                                                                    |                      |                                                                                       |
|--------|----------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------|----------------------------------------------------------------------------------------------------------------------|----------------------|---------------------------------------------------------------------------------------|
| Survey | March 2022                                                                                                                                               | J Smart                            |                                                                                                                      |                      |                                                                                       |
| No.    | Feature & Location                                                                                                                                       | Condition                          | Action                                                                                                               | GR                   | Photograph                                                                            |
| WP26/1 | Gap on definitive path replaced by a locked field gate and a gap created in hedge to side. Fingerpost<br>Access from S side of C1275 road at Bill Mills. | Unauthorised change but practical. | To be kept under review                                                                                              | SO<br>62543<br>21548 |  |
| WP26/2 | Field gate on definitive path now unlocked. Tenant has installed an unauthorised stile to the side. Fingerpost S of Bill Mills                           |                                    | Satisfactory whilst field gate remains unlocked. To be kept under review.                                            | SO<br>62551<br>21557 |  |
| WP26/3 | Wooden stile<br><br>Access from farm track S of Bill Mills                                                                                               | Difficult<br>Path looks well used. | Replace with gate or new stile.<br><b>March 2022</b> – HMPC has rejected WUPPC proposal on cost sharing for new gate | SO<br>62507<br>21408 |  |

| WP27    | E to W                                                                              | C.rd. 250 yds. W of Parkfields                                      | C.rd. 250 yds. WNW of Bill Mills                                                    |                      |                                                                                     |
|---------|-------------------------------------------------------------------------------------|---------------------------------------------------------------------|-------------------------------------------------------------------------------------|----------------------|-------------------------------------------------------------------------------------|
| Survey  | February 2022                                                                       | J Smart                                                             |                                                                                     |                      |                                                                                     |
| No.     | Feature & Location                                                                  | Condition                                                           | Action                                                                              | GR                   | Photograph                                                                          |
| WP27/1  | Steel field gate.<br>Fingerpost.<br>Access from W side of C1275 road at Bill Mills. | No stile sighted.<br>Deep cut stream prevented access heading west. | Check with owner regarding access.<br>Renew Fingerpost                              | SO<br>62567<br>21720 |  |
| WP27/1A | Stream in deep ditch.                                                               | Impassable without a bridge.                                        | <b>March 2022</b><br>Absence of bridge reported to BBLP on 23.May.2021. No response |                      |  |
| WP27/2  | Steel field gate.<br><br>Access from N side of C1275 road, W of Bill Mills.         | No stile sighted.<br>No Fingerpost. No apparent path at this end.   | <b>March 2022</b><br>Reported to BBLP.<br>Renew Fingerpost                          | SO<br>62322<br>21733 |  |

| WP29   | W to E                                                                      | P.bdy. 130 yds. WSE of Hopes Ash Farm                                                                                 | P.bdy. at Palmer Flat |                      |                                                                                       |
|--------|-----------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------|-----------------------|----------------------|---------------------------------------------------------------------------------------|
| Survey | 24-Feb-2019                                                                 | J Smart                                                                                                               |                       |                      |                                                                                       |
| No.    | Feature & Location                                                          | Condition                                                                                                             | Action                | GR                   | Photograph                                                                            |
| WP29/1 | Open access.<br><br>Parish boundary with Hope Mansell on Palmers Flat track | OK. This footpath follows the vehicular track over a very short section where it enters and leaves the parish of WuP. | None                  | SO<br>62880<br>21022 |   |
| WP29/2 | Open access. No stile<br>Way marker for WuP Jubilee Walk.<br>Cattle grid.   | OK.                                                                                                                   | None                  | SO<br>62977<br>20913 |  |

| WP31   | From NW                                                                                      | C.rd. 130 yds. NNE Woodmore Cottage          | C.bdy. a distance of 40 yds. to the E |    |            |
|--------|----------------------------------------------------------------------------------------------|----------------------------------------------|---------------------------------------|----|------------|
| Survey | 24-Feb-2019                                                                                  | J Smart                                      |                                       |    |            |
| No.    | Feature & Location                                                                           | Condition                                    | Action                                | GR | Photograph |
|        | Path off Lea Bailey C1278 road near Hillside leading to Parish and Gloucestershire boundary. | Not found. Possibly not used and grown over. | Presumably none.                      |    | N/A        |

| WP32   | From NW                                                                                          | C. rd. W. of Methodist Chapel                | C. bdy. S. of Methodist Chapel |    |            |
|--------|--------------------------------------------------------------------------------------------------|----------------------------------------------|--------------------------------|----|------------|
| Survey | 24-Feb-2019                                                                                      | J Smart                                      |                                |    |            |
| No.    | Feature & Location                                                                               | Condition                                    | Action                         | GR | Photograph |
|        | Path off Lea Bailey C1278 road near Hoovers Lane leading to Parish and Gloucestershire boundary. | Not found. Possibly not used and grown over. | Presumably none.               |    | N/A        |